

SB: **Garden Pump 3000/4**

Article : **1707**



Reason: Danger of overtorquing the draining plug.

On pumps before index 1406H it can happen that the thread for the draining plug inside the pump body is too short and can be overtorqued . For service purposes a new draining plug with a longer thread was created as a spare part. These plugs will fit on pumps with index later than 1406H too.

Actions: Modification of the thread in the pump body since index 1406H

Spare parts: New locking screw, red art.-no. 1707-00.900.21


Rework : The whole stock in Ulm was reworked and these pumps can be identified by a mark beside the index and a green sticker on the box and the palett :



mark beside the index



green sticker on the box

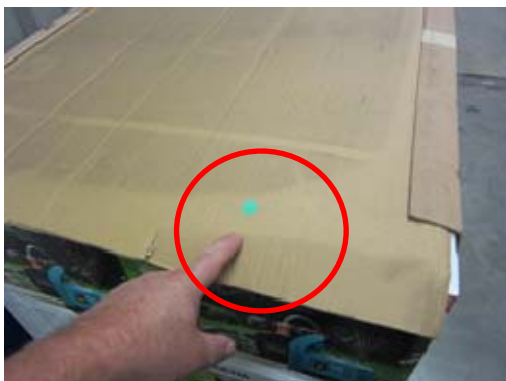

green sticker on the pallet