



## SB, Deck/pivot block damage, Lawnmower, Powermax 36 E, Powermax 42E, 2011-04

### Products involved:

All products of below mentioned models

Model	Gardena number	HVA PNC
Powermax 36 E	4037-20	9669694-01
Powermax 36 E	4037-22	9669695-01
Powermax 36 E	4037-28	9669696-01
Powermax 42E	4043-20	9669697-01
Powermax 42E	4043-22	9669698-01
Powermax 42E	4043-28	9669699-01

### Service information:

To eliminate customer returns regarding deck damage to pivot block/handle area. The solution was to design an insert made from glass filled nylon & fit to deck pivot block area, re-design the pivot block to interface with insert this eliminates damage to PP deck.

Cam lock profile modified to aid customer regarding adjustment

### Implemented in production:

36 GARDENA Date 2011-02-17

42 GARDENA Date 2011-02-23


### Article numbers of blades:

Old Part No: Pivot block 5052548-02, Cam lock 5052551-03

New Part No: Pivot block 55773425-02, Cam lock 5771347-01, Pivot block insert 5777281-68

Due to tuning of the deck to enable inserts to fit correctly & because these modifications had no effect on current products the deck part number did not change.

### Before:

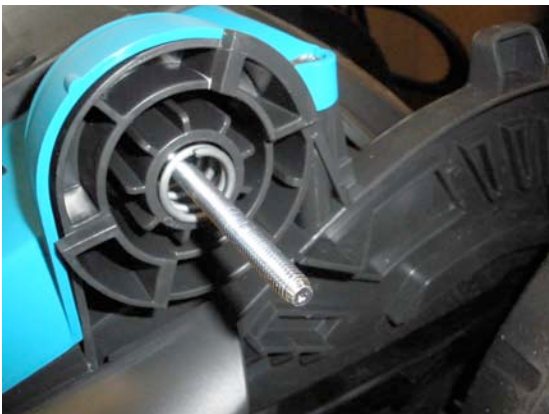

### After:

